

Auditing Test Report

Report No. SA13-4043-07

Date: 21/01/2021

Client

Saudi Vitrified Clay Pipe Co.

P.O. Box 6415

Riyadh 11442

Kingdom of Saudi Arabia

Sampling Date: 16/01/2021

Test Date: 17/01/2021

Auditing Purpose:

Testing of Perforated Vitrified Clay Pipes jointed by system C according to EN 295-5:2013

Size Description:

Nominal Size: DN 400 * 2000 mm Locally Perforated

Joining System: System C

Class: 120

Description of Sampling

Samples were collected randomly from the stock at the client's manufacturing works in Riyadh (Kingdom of Saudi Arabia) by the agent of the Suhaimi - Fugro

Underlying specification /description of the tests


EN 295-1:2013	"Vitrified clay pipe systems for drains and sewers - Part 1: Requirements for pipes, fittings & joints"
EN 295-5:2013	"Vitrified clay pipe systems for drains and sewers - Part 5: Requirements for pipes & fittings"
EN 295-2:2013	"Vitrified clay pipe systems for drains and sewers - Part 2: Evaluation of conformity and sampling"
EN 295-3:2012	"Vitrified clay pipe systems for drains and sewers - Part 3: Test Methods"



Test Results of DN 400 SS LP

Report No. SA13-4043-07

	Test Type	Unit	Sample 1	Sample 2	Sample 3	Req.	Result
Pipes	Marking (visual Inspection)	-	✓	✓	✓	✓	✓
	Crushing Strength	KN/m	70	69	72	≥ 64	✓
	Internal Barrel Diameter "D1"	mm	405	401	406	≥ 390	✓
	Length	mm	2010	2015	2010	2000 ^{+5%} _{-2%}	✓
	Deviation from Straightness	mm	2	2.1	2.1	< 4.0	✓
	Perforation Area	mm ² /m	13133.8			≥ 1200	✓
	Water Absorption	%	5.1	4.6	4.8	≤ 6 %	✓
Joint Assembly	Joint Interchangeability	mm	483.6	483.7	483.8	483.5 ± 0.5	✓
	Continuity of Invert	mm	2.6	2.6	2.4	≤ 4	✓

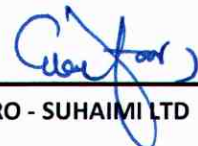

FUGRO - SUHAIMI LTD

Abdul Ghafoor Khawaja

